## **SIEMENS**

Data sheet US2:14HUG32AJ



Non-reversing motor starter Size 3 Three phase full voltage Solid-state overload relay OLRelay amp range 25-100A 24VAC 50-60HZ coil Combination type No enclosure

product brand name	Class 14
design of the product	Full-voltage non-reversing motor starter
special product feature	ESP200 overload relay
General technical data	
weight [lb]	8 lb
Height x Width x Depth [in]	9.78 × 6.75 × 5.19 in
touch protection against electrical shock	Not finger-safe
installation altitude [ft] at height above sea level maximum	6560 ft
ambient temperature [°F]	
<ul> <li>during storage</li> </ul>	-22 +149 °F
during operation	-4 +104 °F
ambient temperature	
during storage	-30 +65 °C
during operation	-20 +40 °C
country of origin	Mexico
Horsepower ratings	
yielded mechanical performance [hp] for 3-phase AC motor	
• at 200/208 V rated value	25 hp
• at 220/230 V rated value	30 hp
• at 460/480 V rated value	50 hp
● at 575/600 V rated value	50 hp
Contactor	
size of contactor	NEMA controller size 3
number of NO contacts for main contacts	3
operating voltage for main current circuit at AC at 60 Hz maximum	600 V
operational current at AC at 600 V rated value	90 A
mechanical service life (operating cycles) of the main contacts typical	5000000
Auxiliary contact	
number of NC contacts at contactor for auxiliary contacts	0
number of NO contacts at contactor for auxiliary contacts	1
number of total auxiliary contacts maximum	7
contact rating of auxiliary contacts of contactor according to UL	10A@600VAC (A600), 5A@600VDC (P600)
Coil	
type of voltage of the control supply voltage	AC
control supply voltage	
<ul> <li>at AC at 50 Hz rated value</li> </ul>	24 V
at AC at 60 Hz rated value	24 V
holding power at AC minimum	14 W
apparent pick-up power of magnet coil at AC	310 VA

	00.1/4
apparent holding power of magnet coil at AC	26 VA
operating range factor control supply voltage rated value of magnet coil	0.85 1.1
percental drop-out voltage of magnet coil related to the input voltage	50 %
ON-delay time	26 41 ms
OFF-delay time	14 19 ms
Overload relay	
product function	
<ul> <li>overload protection</li> </ul>	Yes
phase failure detection	Yes
asymmetry detection	Yes
<ul> <li>ground fault detection</li> </ul>	Yes
• test function	Yes
external reset	No
reset function	Manual, automatic and remote
trip class	CLASS 5 / 10 / 20 (factory set) / 30
adjustable current response value current of the current- dependent overload release	25 100 A
tripping time at phase-loss maximum	3 s
relative repeat accuracy	1 %
product feature protective coating on printed-circuit board	Yes
number of NC contacts of auxiliary contacts of overload relay	1
number of NO contacts of auxiliary contacts of overload relay	1
operational current of auxiliary contacts of overload relay	
• at AC at 600 V	5 A
• at DC at 250 V	1 A
contact rating of auxiliary contacts of overload relay according to UL	5A@600VAC (B600), 1A@250VDC (R300)
insulation voltage (Ui)	
with single-phase operation at AC rated value	600 V
with multi-phase operation at AC rated value	300 V
Enclosure	
degree of protection NEMA rating	Open device (no enclosure)
design of the housing	NA
Mounting/wiring	
mounting position	Vertical
mounting position fastening method	Vertical Surface mounting and installation
fastening method	
fastening method type of electrical connection for supply voltage line-side	Surface mounting and installation
fastening method	Surface mounting and installation  Box lug
fastening method  type of electrical connection for supply voltage line-side tightening torque [lbf·in] for supply type of connectable conductor cross-sections at line-side for	Surface mounting and installation  Box lug  120 120 lbf-in
fastening method type of electrical connection for supply voltage line-side tightening torque [lbf-in] for supply type of connectable conductor cross-sections at line-side for AWG cables single or multi-stranded	Surface mounting and installation  Box lug  120 120 lbf·in  1x(14 - 2/0 AWG)
fastening method type of electrical connection for supply voltage line-side tightening torque [lbf·in] for supply type of connectable conductor cross-sections at line-side for AWG cables single or multi-stranded temperature of the conductor for supply maximum permissible	Surface mounting and installation  Box lug  120 120 lbf-in  1x(14 - 2/0 AWG)  75 °C
fastening method type of electrical connection for supply voltage line-side tightening torque [lbf·in] for supply type of connectable conductor cross-sections at line-side for AWG cables single or multi-stranded temperature of the conductor for supply maximum permissible material of the conductor for supply	Surface mounting and installation  Box lug  120 120 lbf-in  1x(14 - 2/0 AWG)  75 °C  AL or CU
fastening method type of electrical connection for supply voltage line-side tightening torque [lbf·in] for supply type of connectable conductor cross-sections at line-side for AWG cables single or multi-stranded temperature of the conductor for supply maximum permissible material of the conductor for supply type of electrical connection for load-side outgoing feeder	Surface mounting and installation  Box lug  120 120 lbf-in  1x(14 - 2/0 AWG)  75 °C  AL or CU  Box lug
fastening method  type of electrical connection for supply voltage line-side  tightening torque [lbf·in] for supply  type of connectable conductor cross-sections at line-side for  AWG cables single or multi-stranded  temperature of the conductor for supply maximum permissible  material of the conductor for supply  type of electrical connection for load-side outgoing feeder  tightening torque [lbf·in] for load-side outgoing feeder  type of connectable conductor cross-sections for AWG cables	Surface mounting and installation  Box lug  120 120 lbf·in  1x(14 - 2/0 AWG)  75 °C  AL or CU  Box lug  120 120 lbf·in
fastening method  type of electrical connection for supply voltage line-side  tightening torque [lbf·in] for supply  type of connectable conductor cross-sections at line-side for  AWG cables single or multi-stranded  temperature of the conductor for supply maximum permissible  material of the conductor for supply  type of electrical connection for load-side outgoing feeder  tightening torque [lbf·in] for load-side outgoing feeder  type of connectable conductor cross-sections for AWG cables for load-side outgoing feeder single or multi-stranded  temperature of the conductor for load-side outgoing feeder	Surface mounting and installation  Box lug  120 120 lbf·in  1x(14 - 2/0 AWG)  75 °C  AL or CU  Box lug  120 120 lbf·in  1x(14 - 2/0 AWG)
fastening method  type of electrical connection for supply voltage line-side  tightening torque [lbf-in] for supply  type of connectable conductor cross-sections at line-side for AWG cables single or multi-stranded  temperature of the conductor for supply maximum permissible  material of the conductor for supply  type of electrical connection for load-side outgoing feeder  tightening torque [lbf-in] for load-side outgoing feeder  type of connectable conductor cross-sections for AWG cables for load-side outgoing feeder single or multi-stranded  temperature of the conductor for load-side outgoing feeder  maximum permissible	Surface mounting and installation  Box lug  120 120 lbf·in  1x(14 - 2/0 AWG)  75 °C  AL or CU  Box lug  120 120 lbf·in  1x(14 - 2/0 AWG)  75 °C
fastening method  type of electrical connection for supply voltage line-side tightening torque [lbf-in] for supply  type of connectable conductor cross-sections at line-side for AWG cables single or multi-stranded  temperature of the conductor for supply maximum permissible material of the conductor for supply type of electrical connection for load-side outgoing feeder tightening torque [lbf-in] for load-side outgoing feeder type of connectable conductor cross-sections for AWG cables for load-side outgoing feeder single or multi-stranded temperature of the conductor for load-side outgoing feeder maximum permissible material of the conductor for load-side outgoing feeder	Surface mounting and installation  Box lug  120 120 lbf-in  1x(14 - 2/0 AWG)  75 °C  AL or CU  Box lug  120 120 lbf-in  1x(14 - 2/0 AWG)  75 °C  AL or CU  AL or CU
fastening method  type of electrical connection for supply voltage line-side  tightening torque [lbf-in] for supply  type of connectable conductor cross-sections at line-side for AWG cables single or multi-stranded  temperature of the conductor for supply maximum permissible  material of the conductor for supply  type of electrical connection for load-side outgoing feeder  tightening torque [lbf-in] for load-side outgoing feeder  type of connectable conductor cross-sections for AWG cables for load-side outgoing feeder single or multi-stranded  temperature of the conductor for load-side outgoing feeder  maximum permissible  material of the conductor for load-side outgoing feeder  type of electrical connection of magnet coil	Surface mounting and installation  Box lug  120 120 lbf-in  1x(14 - 2/0 AWG)  75 °C  AL or CU  Box lug  120 120 lbf-in  1x(14 - 2/0 AWG)  75 °C  AL or CU  screw-type terminals
fastening method  type of electrical connection for supply voltage line-side  tightening torque [lbf-in] for supply  type of connectable conductor cross-sections at line-side for AWG cables single or multi-stranded  temperature of the conductor for supply maximum permissible  material of the conductor for supply  type of electrical connection for load-side outgoing feeder  tightening torque [lbf-in] for load-side outgoing feeder  type of connectable conductor cross-sections for AWG cables for load-side outgoing feeder single or multi-stranded  temperature of the conductor for load-side outgoing feeder maximum permissible  material of the conductor for load-side outgoing feeder  type of electrical connection of magnet coil  tightening torque [lbf-in] at magnet coil  type of connectable conductor cross-sections of magnet coil for	Surface mounting and installation  Box lug  120 120 lbf-in  1x(14 - 2/0 AWG)  75 °C  AL or CU  Box lug  120 120 lbf-in  1x(14 - 2/0 AWG)  75 °C  AL or CU  screw-type terminals  5 12 lbf-in
fastening method  type of electrical connection for supply voltage line-side  tightening torque [lbf-in] for supply  type of connectable conductor cross-sections at line-side for AWG cables single or multi-stranded  temperature of the conductor for supply maximum permissible  material of the conductor for supply  type of electrical connection for load-side outgoing feeder  tightening torque [lbf-in] for load-side outgoing feeder  type of connectable conductor cross-sections for AWG cables for load-side outgoing feeder single or multi-stranded  temperature of the conductor for load-side outgoing feeder  maximum permissible  material of the conductor for load-side outgoing feeder  type of electrical connection of magnet coil  tightening torque [lbf-in] at magnet coil  type of connectable conductor cross-sections of magnet coil for  AWG cables single or multi-stranded  temperature of the conductor at magnet coil maximum	Surface mounting and installation  Box lug  120 120 lbf-in  1x(14 - 2/0 AWG)  75 °C  AL or CU  Box lug  120 120 lbf-in  1x(14 - 2/0 AWG)  75 °C  AL or CU  screw-type terminals  5 12 lbf-in  2 x (16 - 12 AWG)
fastening method  type of electrical connection for supply voltage line-side  tightening torque [lbf-in] for supply  type of connectable conductor cross-sections at line-side for AWG cables single or multi-stranded  temperature of the conductor for supply maximum permissible  material of the conductor for supply  type of electrical connection for load-side outgoing feeder  tightening torque [lbf-in] for load-side outgoing feeder  type of connectable conductor cross-sections for AWG cables for load-side outgoing feeder single or multi-stranded  temperature of the conductor for load-side outgoing feeder  maximum permissible  material of the conductor for load-side outgoing feeder  type of electrical connection of magnet coil  tightening torque [lbf-in] at magnet coil  type of connectable conductor cross-sections of magnet coil for  AWG cables single or multi-stranded  temperature of the conductor at magnet coil maximum permissible	Surface mounting and installation  Box lug  120 120 lbf-in  1x(14 - 2/0 AWG)  75 °C  AL or CU  Box lug  120 120 lbf-in  1x(14 - 2/0 AWG)  75 °C  AL or CU  screw-type terminals  5 12 lbf-in  2 x (16 - 12 AWG)  75 °C
fastening method  type of electrical connection for supply voltage line-side  tightening torque [lbf-in] for supply  type of connectable conductor cross-sections at line-side for AWG cables single or multi-stranded  temperature of the conductor for supply maximum permissible  material of the conductor for supply  type of electrical connection for load-side outgoing feeder  tightening torque [lbf-in] for load-side outgoing feeder  type of connectable conductor cross-sections for AWG cables for load-side outgoing feeder single or multi-stranded  temperature of the conductor for load-side outgoing feeder  maximum permissible  material of the conductor for load-side outgoing feeder  type of electrical connection of magnet coil  tightening torque [lbf-in] at magnet coil  type of connectable conductor cross-sections of magnet coil for  AWG cables single or multi-stranded  temperature of the conductor at magnet coil maximum  permissible  material of the conductor at magnet coil	Surface mounting and installation  Box lug  120 120 lbf·in  1x(14 - 2/0 AWG)  75 °C  AL or CU  Box lug  120 120 lbf·in  1x(14 - 2/0 AWG)  75 °C  AL or CU  screw-type terminals  5 12 lbf·in  2 x (16 - 12 AWG)  75 °C  CU
fastening method  type of electrical connection for supply voltage line-side  tightening torque [lbf-in] for supply  type of connectable conductor cross-sections at line-side for AWG cables single or multi-stranded  temperature of the conductor for supply maximum permissible  material of the conductor for supply  type of electrical connection for load-side outgoing feeder  tightening torque [lbf-in] for load-side outgoing feeder  type of connectable conductor cross-sections for AWG cables for load-side outgoing feeder single or multi-stranded  temperature of the conductor for load-side outgoing feeder  maximum permissible  material of the conductor for load-side outgoing feeder  type of electrical connection of magnet coil  tightening torque [lbf-in] at magnet coil  type of connectable conductor cross-sections of magnet coil for AWG cables single or multi-stranded  temperature of the conductor at magnet coil maximum permissible  material of the conductor at magnet coil maximum permissible	Surface mounting and installation  Box lug  120 120 lbf-in  1x(14 - 2/0 AWG)  75 °C  AL or CU  Box lug  120 120 lbf-in  1x(14 - 2/0 AWG)  75 °C  AL or CU  screw-type terminals  5 12 lbf-in  2 x (16 - 12 AWG)  75 °C  CU  screw-type terminals

material of the conductor at contactor for auxiliary contacts	CU
type of electrical connection at overload relay for auxiliary contacts	screw-type terminals
tightening torque [lbf·in] at overload relay for auxiliary contacts	7 10 lbf·in
type of connectable conductor cross-sections at overload relay for AWG cables for auxiliary contacts single or multi-stranded	2 x (20 - 14 AWG)
temperature of the conductor at overload relay for auxiliary contacts maximum permissible	75 °C
material of the conductor at overload relay for auxiliary contacts	CU
Short-circuit current rating	
design of the fuse link for short-circuit protection of the main circuit required	10kA@600V (Class H or K); 100kA@600V (Class R or J)
design of the short-circuit trip	Thermal magnetic circuit breaker
maximum short-circuit current breaking capacity (Icu)	
● at 240 V	14 kA
1.400.17	10 kA
• at 480 V	10 10 1
at 480 V     at 600 V	10 kA

Industrial Controls - Product Overview (Catalogs, Brochures,...)

www.usa.siemens.com/iccatalog

Industry Mall (Online ordering system)

https://mall.industry.siemens.com/mall/en/us/Catalog/product?mlfb=US2:14HUG32AJ


Service&Support (Manuals, Certificates, Characteristics, FAQs,...)


https://support.industry.siemens.com/cs/US/en/ps/US2:14HUG32AJ


Image database (product images, 2D dimension drawings, 3D models, device circuit diagrams, EPLAN macros, ...) <a href="http://www.automation.siemens.com/bilddb/cax\_de.aspx?mlfb=US2:14HUG32AJ&lang=en">http://www.automation.siemens.com/bilddb/cax\_de.aspx?mlfb=US2:14HUG32AJ&lang=en</a>

Certificates/approvals

https://support.industry.siemens.com/cs/US/en/ps/US2:14HUG32AJ/certificate

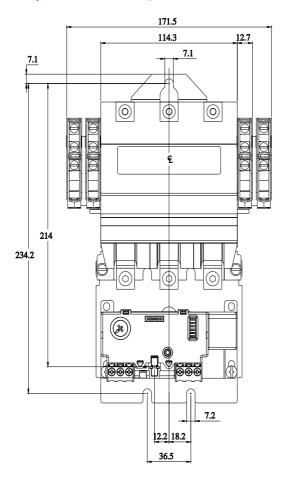

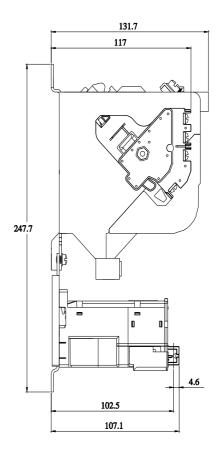

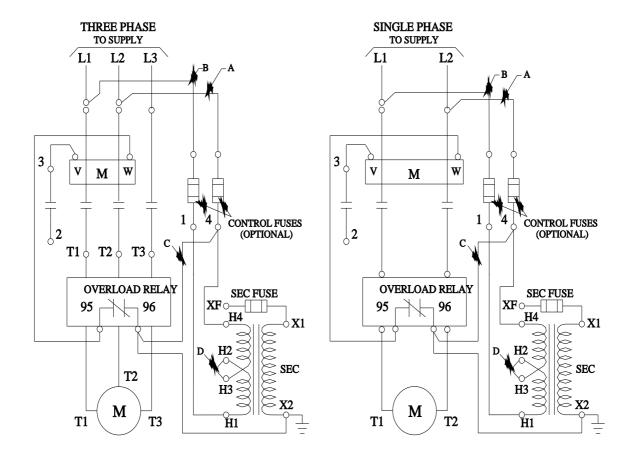

last modified: 11/29/2021 🖸