SIEMENS

Data sheet US2:18JUH92XH



Non-reversing motor starter, Size 4, Three phase full voltage, Solid-state overload relay, OLR amp range 50-200A, Combination type, 150A circuit breaker, Encl NEMA type 4X 316 S-Steel, Water/dust tight noncorrosive, Standard width enclosure

product brand name	Class 18 & 26
design of the product	Full-voltage non-reversing motor starter with motor circuit protector
special product feature	ESP200 overload relay
General technical data	
Height x Width x Depth [in]	36 × 24 × 8 in
touch protection against electrical shock	NA for enclosed products
installation altitude [ft] at height above sea level maximum	6560 ft
ambient temperature [°F]	
during storage	-22 +149 °F
during operation	-4 +104 °F
ambient temperature	
 during storage 	-30 +65 °C
 during operation 	-20 +40 °C
Horsepower ratings	
yielded mechanical performance [hp] for 3-phase AC motor	
• at 200/208 V rated value	40 hp
• at 220/230 V rated value	50 hp
• at 460/480 V rated value	100 hp
• at 575/600 V rated value	100 hp
Contactor	
size of contactor	NEMA controller size 4
number of NO contacts for main contacts	3
operating voltage for main current circuit at AC at 60 Hz maximum	600 V
operational current at AC at 600 V rated value	135 A
mechanical service life (operating cycles) of the main contacts typical	5000000
Auxiliary contact	
number of NC contacts at contactor for auxiliary contacts	0
number of NO contacts at contactor for auxiliary contacts	1
number of total auxiliary contacts maximum	7
contact rating of auxiliary contacts of contactor according to UL	10A@600VAC (A600), 5A@600VDC (P600)
Coil	
type of voltage of the control supply voltage	AC
control supply voltage	
 at AC at 50 Hz rated value 	380 440 V
at AC at 60 Hz rated value	440 480 V
holding power at AC minimum	22 W
apparent pick-up power of magnet coil at AC	510 VA
apparent holding power of magnet coil at AC	51 VA
operating range factor control supply voltage rated value of	0.85 1.1

magnet coil	
percental drop-out voltage of magnet coil related to the input voltage	50 %
ON-delay time	18 34 ms
OFF-delay time	10 12 ms
Overload relay	
reset function	Manual, automatic and remote
trip class	CLASS 5 / 10 / 20 (factory set) / 30
adjustable current response value current of the current- dependent overload release	50 200 A
make time with automatic start after power failure maximum	3 s
relative repeat accuracy	1 %
number of NC contacts of auxiliary contacts of overload relay	1
number of NO contacts of auxiliary contacts of overload relay	1
operational current of auxiliary contacts of overload relay	
• at AC at 600 V	5 A
• at DC at 250 V	1 A
contact rating of auxiliary contacts of overload relay according to UL	5A@600VAC (B600), 1A@250VDC (R300)
insulation voltage (Ui)	
with single-phase operation at AC rated value	600 V
with multi-phase operation at AC rated value	300 V
Enclosure	
degree of protection NEMA rating	4X, 304 stainless steel
design of the housing	dustproof, waterproof & resistant to corrosion
Circuit Breaker	
type of the motor protection	Motor circuit protector (magnetic trip only)
operational current of motor circuit breaker rated value	150 A
adjustable current response value current of instantaneous short-circuit trip unit	800 1500 A
Mounting/wining	
Mounting/wiring	
mounting position	Vertical
	Vertical Surface mounting and installation
mounting position fastening method type of electrical connection for supply voltage line-side	Surface mounting and installation Box lug
mounting position fastening method type of electrical connection for supply voltage line-side type of connectable conductor cross-sections at line-side for AWG cables single or multi-stranded	Surface mounting and installation Box lug 1x (6 AWG 350 Kcmil) or 1x (4 AWG 350 Kcmil)
mounting position fastening method type of electrical connection for supply voltage line-side type of connectable conductor cross-sections at line-side for AWG cables single or multi-stranded temperature of the conductor for supply maximum permissible	Surface mounting and installation Box lug 1x (6 AWG 350 Kcmil) or 1x (4 AWG 350 Kcmil) 75 °C
mounting position fastening method type of electrical connection for supply voltage line-side type of connectable conductor cross-sections at line-side for AWG cables single or multi-stranded	Surface mounting and installation Box lug 1x (6 AWG 350 Kcmil) or 1x (4 AWG 350 Kcmil) 75 °C AL or CU
mounting position fastening method type of electrical connection for supply voltage line-side type of connectable conductor cross-sections at line-side for AWG cables single or multi-stranded temperature of the conductor for supply maximum permissible	Surface mounting and installation Box lug 1x (6 AWG 350 Kcmil) or 1x (4 AWG 350 Kcmil) 75 °C AL or CU Box lug
mounting position fastening method type of electrical connection for supply voltage line-side type of connectable conductor cross-sections at line-side for AWG cables single or multi-stranded temperature of the conductor for supply maximum permissible material of the conductor for supply type of electrical connection for load-side outgoing feeder tightening torque [lbf-in] for load-side outgoing feeder	Surface mounting and installation Box lug 1x (6 AWG 350 Kcmil) or 1x (4 AWG 350 Kcmil) 75 °C AL or CU Box lug 200 200 lbf·in
mounting position fastening method type of electrical connection for supply voltage line-side type of connectable conductor cross-sections at line-side for AWG cables single or multi-stranded temperature of the conductor for supply maximum permissible material of the conductor for supply type of electrical connection for load-side outgoing feeder	Surface mounting and installation Box lug 1x (6 AWG 350 Kcmil) or 1x (4 AWG 350 Kcmil) 75 °C AL or CU Box lug 200 200 lbf·in 1x (6 AWG 250 MCM)
mounting position fastening method type of electrical connection for supply voltage line-side type of connectable conductor cross-sections at line-side for AWG cables single or multi-stranded temperature of the conductor for supply maximum permissible material of the conductor for supply type of electrical connection for load-side outgoing feeder tightening torque [lbf-in] for load-side outgoing feeder type of connectable conductor cross-sections for AWG cables for load-side outgoing feeder single or multi-stranded temperature of the conductor for load-side outgoing feeder maximum permissible	Surface mounting and installation Box lug 1x (6 AWG 350 Kcmil) or 1x (4 AWG 350 Kcmil) 75 °C AL or CU Box lug 200 200 lbf-in 1x (6 AWG 250 MCM)
mounting position fastening method type of electrical connection for supply voltage line-side type of connectable conductor cross-sections at line-side for AWG cables single or multi-stranded temperature of the conductor for supply maximum permissible material of the conductor for supply type of electrical connection for load-side outgoing feeder tightening torque [lbf-in] for load-side outgoing feeder type of connectable conductor cross-sections for AWG cables for load-side outgoing feeder single or multi-stranded temperature of the conductor for load-side outgoing feeder maximum permissible material of the conductor for load-side outgoing feeder	Surface mounting and installation Box lug 1x (6 AWG 350 Kcmil) or 1x (4 AWG 350 Kcmil) 75 °C AL or CU Box lug 200 200 lbf-in 1x (6 AWG 250 MCM) 75 °C CU
mounting position fastening method type of electrical connection for supply voltage line-side type of connectable conductor cross-sections at line-side for AWG cables single or multi-stranded temperature of the conductor for supply maximum permissible material of the conductor for supply type of electrical connection for load-side outgoing feeder tightening torque [lbf-in] for load-side outgoing feeder type of connectable conductor cross-sections for AWG cables for load-side outgoing feeder single or multi-stranded temperature of the conductor for load-side outgoing feeder maximum permissible	Surface mounting and installation Box lug 1x (6 AWG 350 Kcmil) or 1x (4 AWG 350 Kcmil) 75 °C AL or CU Box lug 200 200 lbf-in 1x (6 AWG 250 MCM) 75 °C CU Screw-type terminals
mounting position fastening method type of electrical connection for supply voltage line-side type of connectable conductor cross-sections at line-side for AWG cables single or multi-stranded temperature of the conductor for supply maximum permissible material of the conductor for supply type of electrical connection for load-side outgoing feeder tightening torque [lbf-in] for load-side outgoing feeder type of connectable conductor cross-sections for AWG cables for load-side outgoing feeder single or multi-stranded temperature of the conductor for load-side outgoing feeder maximum permissible material of the conductor for load-side outgoing feeder type of electrical connection of magnet coil tightening torque [lbf-in] at magnet coil	Surface mounting and installation Box lug 1x (6 AWG 350 Kcmil) or 1x (4 AWG 350 Kcmil) 75 °C AL or CU Box lug 200 200 lbf-in 1x (6 AWG 250 MCM) 75 °C CU
mounting position fastening method type of electrical connection for supply voltage line-side type of connectable conductor cross-sections at line-side for AWG cables single or multi-stranded temperature of the conductor for supply maximum permissible material of the conductor for supply type of electrical connection for load-side outgoing feeder tightening torque [lbf-in] for load-side outgoing feeder type of connectable conductor cross-sections for AWG cables for load-side outgoing feeder single or multi-stranded temperature of the conductor for load-side outgoing feeder maximum permissible material of the conductor for load-side outgoing feeder type of electrical connection of magnet coil tightening torque [lbf-in] at magnet coil type of connectable conductor cross-sections of magnet coil for AWG cables single or multi-stranded temperature of the conductor at magnet coil maximum	Surface mounting and installation Box lug 1x (6 AWG 350 Kcmil) or 1x (4 AWG 350 Kcmil) 75 °C AL or CU Box lug 200 200 lbf-in 1x (6 AWG 250 MCM) 75 °C CU Screw-type terminals 5 12 lbf-in
mounting position fastening method type of electrical connection for supply voltage line-side type of connectable conductor cross-sections at line-side for AWG cables single or multi-stranded temperature of the conductor for supply maximum permissible material of the conductor for supply type of electrical connection for load-side outgoing feeder tightening torque [lbf-in] for load-side outgoing feeder type of connectable conductor cross-sections for AWG cables for load-side outgoing feeder single or multi-stranded temperature of the conductor for load-side outgoing feeder maximum permissible material of the conductor for load-side outgoing feeder type of electrical connection of magnet coil tightening torque [lbf-in] at magnet coil type of connectable conductor cross-sections of magnet coil for AWG cables single or multi-stranded temperature of the conductor at magnet coil maximum permissible	Surface mounting and installation Box lug 1x (6 AWG 350 Kcmil) or 1x (4 AWG 350 Kcmil) 75 °C AL or CU Box lug 200 200 lbf-in 1x (6 AWG 250 MCM) 75 °C CU Screw-type terminals 5 12 lbf-in 2x (16 12 AWG)
mounting position fastening method type of electrical connection for supply voltage line-side type of connectable conductor cross-sections at line-side for AWG cables single or multi-stranded temperature of the conductor for supply maximum permissible material of the conductor for supply type of electrical connection for load-side outgoing feeder tightening torque [lbf-in] for load-side outgoing feeder type of connectable conductor cross-sections for AWG cables for load-side outgoing feeder single or multi-stranded temperature of the conductor for load-side outgoing feeder maximum permissible material of the conductor for load-side outgoing feeder type of electrical connection of magnet coil tightening torque [lbf-in] at magnet coil type of connectable conductor cross-sections of magnet coil for AWG cables single or multi-stranded temperature of the conductor at magnet coil maximum permissible material of the conductor at magnet coil	Surface mounting and installation Box lug 1x (6 AWG 350 Kcmil) or 1x (4 AWG 350 Kcmil) 75 °C AL or CU Box lug 200 200 lbf-in 1x (6 AWG 250 MCM) 75 °C CU Screw-type terminals 5 12 lbf-in 2x (16 12 AWG) 75 °C CU
mounting position fastening method type of electrical connection for supply voltage line-side type of connectable conductor cross-sections at line-side for AWG cables single or multi-stranded temperature of the conductor for supply maximum permissible material of the conductor for supply type of electrical connection for load-side outgoing feeder tightening torque [lbf-in] for load-side outgoing feeder type of connectable conductor cross-sections for AWG cables for load-side outgoing feeder single or multi-stranded temperature of the conductor for load-side outgoing feeder maximum permissible material of the conductor for load-side outgoing feeder type of electrical connection of magnet coil tightening torque [lbf-in] at magnet coil type of connectable conductor cross-sections of magnet coil for AWG cables single or multi-stranded temperature of the conductor at magnet coil maximum permissible material of the conductor at magnet coil maximum permissible	Surface mounting and installation Box lug 1x (6 AWG 350 Kcmil) or 1x (4 AWG 350 Kcmil) 75 °C AL or CU Box lug 200 200 lbf-in 1x (6 AWG 250 MCM) 75 °C CU Screw-type terminals 5 12 lbf-in 2x (16 12 AWG) 75 °C CU Screw-type terminals
mounting position fastening method type of electrical connection for supply voltage line-side type of connectable conductor cross-sections at line-side for AWG cables single or multi-stranded temperature of the conductor for supply maximum permissible material of the conductor for supply type of electrical connection for load-side outgoing feeder tightening torque [lbf-in] for load-side outgoing feeder type of connectable conductor cross-sections for AWG cables for load-side outgoing feeder single or multi-stranded temperature of the conductor for load-side outgoing feeder maximum permissible material of the conductor for load-side outgoing feeder type of electrical connection of magnet coil tightening torque [lbf-in] at magnet coil type of connectable conductor cross-sections of magnet coil for AWG cables single or multi-stranded temperature of the conductor at magnet coil maximum permissible material of the conductor at magnet coil maximum permissible	Surface mounting and installation Box lug 1x (6 AWG 350 Kcmil) or 1x (4 AWG 350 Kcmil) 75 °C AL or CU Box lug 200 200 lbf-in 1x (6 AWG 250 MCM) 75 °C CU Screw-type terminals 5 12 lbf-in 2x (16 12 AWG) 75 °C CU Screw-type terminals 10 15 lbf-in
mounting position fastening method type of electrical connection for supply voltage line-side type of connectable conductor cross-sections at line-side for AWG cables single or multi-stranded temperature of the conductor for supply maximum permissible material of the conductor for supply type of electrical connection for load-side outgoing feeder tightening torque [lbf-in] for load-side outgoing feeder type of connectable conductor cross-sections for AWG cables for load-side outgoing feeder single or multi-stranded temperature of the conductor for load-side outgoing feeder maximum permissible material of the conductor for load-side outgoing feeder type of electrical connection of magnet coil tightening torque [lbf-in] at magnet coil type of connectable conductor cross-sections of magnet coil for AWG cables single or multi-stranded temperature of the conductor at magnet coil maximum permissible material of the conductor at magnet coil type of electrical connection for auxiliary contacts tightening torque [lbf-in] at contactor for auxiliary contacts tightening torque [lbf-in] at contactor for auxiliary contacts	Surface mounting and installation Box lug 1x (6 AWG 350 Kcmil) or 1x (4 AWG 350 Kcmil) 75 °C AL or CU Box lug 200 200 lbf-in 1x (6 AWG 250 MCM) 75 °C CU Screw-type terminals 5 12 lbf-in 2x (16 12 AWG) 75 °C CU Screw-type terminals 10 15 lbf-in 1x (12 AWG), 2x (16 14 AWG), 2x (18 16 AWG)
mounting position fastening method type of electrical connection for supply voltage line-side type of connectable conductor cross-sections at line-side for AWG cables single or multi-stranded temperature of the conductor for supply maximum permissible material of the conductor for supply type of electrical connection for load-side outgoing feeder tightening torque [lbf-in] for load-side outgoing feeder type of connectable conductor cross-sections for AWG cables for load-side outgoing feeder single or multi-stranded temperature of the conductor for load-side outgoing feeder maximum permissible material of the conductor for load-side outgoing feeder type of electrical connection of magnet coil tightening torque [lbf-in] at magnet coil type of connectable conductor cross-sections of magnet coil for AWG cables single or multi-stranded temperature of the conductor at magnet coil maximum permissible material of the conductor at magnet coil type of electrical connection for auxiliary contacts tightening torque [lbf-in] at contactor for auxiliary contacts tightening torque [lbf-in] at contactor for auxiliary contacts type of connectable conductor cross-sections at contactor for AWG cables for auxiliary contacts single or multi-stranded temperature of the conductor at contactor for auxiliary contacts maximum permissible	Surface mounting and installation Box lug 1x (6 AWG 350 Kcmil) or 1x (4 AWG 350 Kcmil) 75 °C AL or CU Box lug 200 200 lbf-in 1x (6 AWG 250 MCM) 75 °C CU Screw-type terminals 5 12 lbf-in 2x (16 12 AWG) 75 °C CU Screw-type terminals 10 15 lbf-in 1x (12 AWG), 2x (16 14 AWG), 2x (18 16 AWG) 75 °C
mounting position fastening method type of electrical connection for supply voltage line-side type of connectable conductor cross-sections at line-side for AWG cables single or multi-stranded temperature of the conductor for supply maximum permissible material of the conductor for supply type of electrical connection for load-side outgoing feeder tightening torque [lbf-in] for load-side outgoing feeder type of connectable conductor cross-sections for AWG cables for load-side outgoing feeder single or multi-stranded temperature of the conductor for load-side outgoing feeder maximum permissible material of the conductor for load-side outgoing feeder type of electrical connection of magnet coil tightening torque [lbf-in] at magnet coil type of connectable conductor cross-sections of magnet coil for AWG cables single or multi-stranded temperature of the conductor at magnet coil maximum permissible material of the conductor at magnet coil type of electrical connection for auxiliary contacts tightening torque [lbf-in] at contactor for auxiliary contacts type of connectable conductor cross-sections at contactor for AWG cables for auxiliary contacts single or multi-stranded temperature of the conductor at contactor for auxiliary contacts maximum permissible material of the conductor at contactor for auxiliary contacts maximum permissible	Surface mounting and installation Box lug 1x (6 AWG 350 Kcmil) or 1x (4 AWG 350 Kcmil) 75 °C AL or CU Box lug 200 200 lbf-in 1x (6 AWG 250 MCM) 75 °C CU Screw-type terminals 5 12 lbf-in 2x (16 12 AWG) 75 °C CU Screw-type terminals 10 15 lbf-in 1x (12 AWG), 2x (16 14 AWG), 2x (18 16 AWG) 75 °C CU
mounting position fastening method type of electrical connection for supply voltage line-side type of connectable conductor cross-sections at line-side for AWG cables single or multi-stranded temperature of the conductor for supply maximum permissible material of the conductor for supply type of electrical connection for load-side outgoing feeder tightening torque [lbf-in] for load-side outgoing feeder type of connectable conductor cross-sections for AWG cables for load-side outgoing feeder single or multi-stranded temperature of the conductor for load-side outgoing feeder maximum permissible material of the conductor for load-side outgoing feeder type of electrical connection of magnet coil tightening torque [lbf-in] at magnet coil type of connectable conductor cross-sections of magnet coil for AWG cables single or multi-stranded temperature of the conductor at magnet coil maximum permissible material of the conductor at magnet coil type of electrical connection for auxiliary contacts tightening torque [lbf-in] at contactor for auxiliary contacts type of connectable conductor cross-sections at contactor for AWG cables for auxiliary contacts single or multi-stranded temperature of the conductor at contactor for auxiliary contacts maximum permissible material of the conductor at contactor for auxiliary contacts type of electrical connection at overload relay for auxiliary contacts	Surface mounting and installation Box lug 1x (6 AWG 350 Kcmil) or 1x (4 AWG 350 Kcmil) 75 °C AL or CU Box lug 200 200 lbf-in 1x (6 AWG 250 MCM) 75 °C CU Screw-type terminals 5 12 lbf-in 2x (16 12 AWG) 75 °C CU Screw-type terminals 10 15 lbf-in 1x (12 AWG), 2x (16 14 AWG), 2x (18 16 AWG) 75 °C CU Screw-type terminals
mounting position fastening method type of electrical connection for supply voltage line-side type of connectable conductor cross-sections at line-side for AWG cables single or multi-stranded temperature of the conductor for supply maximum permissible material of the conductor for supply type of electrical connection for load-side outgoing feeder tightening torque [lbf-in] for load-side outgoing feeder type of connectable conductor cross-sections for AWG cables for load-side outgoing feeder single or multi-stranded temperature of the conductor for load-side outgoing feeder maximum permissible material of the conductor for load-side outgoing feeder type of electrical connection of magnet coil tightening torque [lbf-in] at magnet coil type of connectable conductor cross-sections of magnet coil for AWG cables single or multi-stranded temperature of the conductor at magnet coil maximum permissible material of the conductor at magnet coil type of electrical connection for auxiliary contacts tightening torque [lbf-in] at contactor for auxiliary contacts tightening torque [lbf-in] at contactor for auxiliary contacts type of connectable conductor at contactor for auxiliary contacts type of connectable conductor at contactor for auxiliary contacts maximum permissible material of the conductor at contactor for auxiliary contacts maximum permissible material of the conductor at contactor for auxiliary contacts maximum permissible	Surface mounting and installation Box lug 1x (6 AWG 350 Kcmil) or 1x (4 AWG 350 Kcmil) 75 °C AL or CU Box lug 200 200 lbf-in 1x (6 AWG 250 MCM) 75 °C CU Screw-type terminals 5 12 lbf-in 2x (16 12 AWG) 75 °C CU Screw-type terminals 10 15 lbf-in 1x (12 AWG), 2x (16 14 AWG), 2x (18 16 AWG) 75 °C CU

temperature of the conductor at overload relay for auxiliary contacts maximum permissible	75 °C
material of the conductor at overload relay for auxiliary contacts	CU
Short-circuit current rating	
design of the short-circuit trip	Instantaneous trip circuit breaker
maximum short-circuit current breaking capacity (Icu)	
• at 240 V	100 kA
• at 480 V	100 kA
• at 600 V	25 kA
certificate of suitability	NEMA ICS 2; UL 508; CSA 22.2, No.14
Further information	

Industrial Controls - Product Overview (Catalogs, Brochures,...)

www.usa.siemens.com/iccatalog

Industry Mall (Online ordering system)


https://mall.industry.siemens.com/mall/en/us/Catalog/product?mlfb=US2:18JUH92XH


Service&Support (Manuals, Certificates, Characteristics, FAQs,...) https://support.industry.siemens.com/cs/US/en/ps/US2:18JUH92XH

Image database (product images, 2D dimension drawings, 3D models, device circuit diagrams, EPLAN macros, ...) http://www.automation.siemens.com/bilddb/cax_de.aspx?mlfb=US2:18JUH92XH&lang=en

Certificates/approvals

https://support.industry.siemens.com/cs/US/en/ps/US2:18JUH92XH/certificate

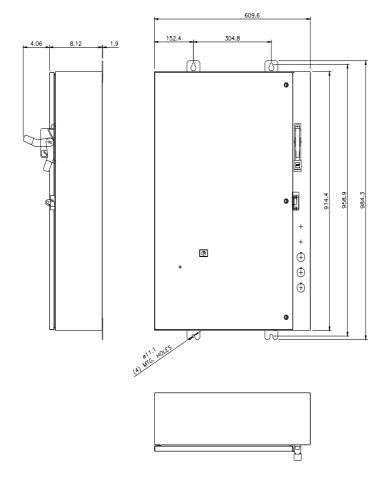

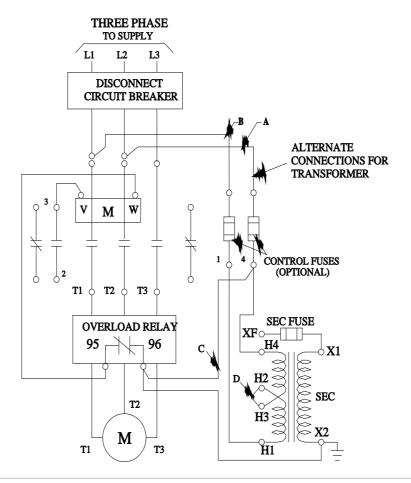

last modified: 1/25/2022 🖸