

LOG-0003-200G-8GB-PC

The Slam Stick C 200g has been discontinued and replaced by the <u>S3-D16</u> or the <u>S2-D40D200</u>. There are also many other new and updated products you can compare on <u>our sensors page</u>. If you have any questions, <u>we're here to help!</u>

Why enDAQ?
Demo with an Engineer
Visit our Help Center
Customer Testimonials
Contact Customer
Success

PLEASE NOTE: BACKORDERED PRODUCTS:

Due to the global chip shortage, some of our products are on backorder.

We sincerely apologize for the inconvenience and are working tirelessly to transition to a more readily available microprocessor. In the meantime, if you have any questions, please do not hesitate to reach out to our <u>Customer Success Team</u>.



Complimentary enDAQ Pelican case included with every <u>enDAQ® sensor</u> order. Additional cases can be purchased here: <u>enDAQ Accessories</u>

Product Features

Convenient

- Standalone measurement system with sensors, storage & rechargeable battery
- Handheld form factor
- Setup in minutes over USB interface

Adaptable

- · Multiple accelerometers for dynamic range
- Many additional embedded sensors into single system
- User-programmable wake-up conditions and sample rates

Reliable

- Trusted in harsh environments by over 2,000 customers & the US Navy
- Calibrated with NIST Traceable Accelerometer | <u>Benefits</u> | <u>Calibration</u> Certificate
- · Storage capacity for billions of data points


Accelerometer Specifications>> More Information

Accelerometer Type Range Sampling Rate Bandwidth Noise Resolution

Digital Capacitive $\pm 200g$ 3,200 Hz $\begin{array}{c} 0 \text{ to } 300 \\ \text{Hz} \end{array}$ < 0.14 gRMS 0.05 g

Frequency Response Plot



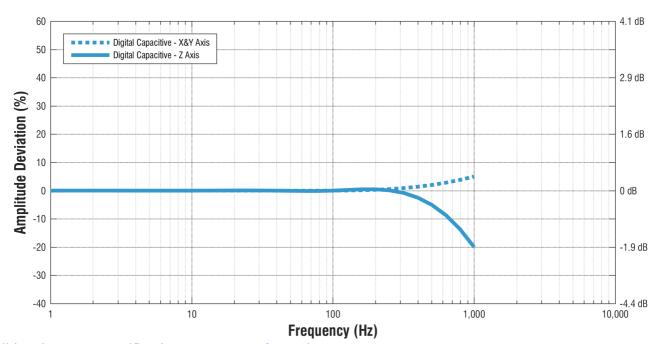

Additional Sensor Specifications >> More Information

Measurement Range Resolution Sampling Rate Sensor 0 (off) to 200 0.06 °/s Gyroscope 2000°/s Hz Magnetometer ± 1300 μT 0.3 µT 0 (off) to 10 Hz Temperature -40 to 85 °C 0.01 °C 0 (off) to 10 Hz Pressure 1 to 200 kPa 1.6 Pa 0 (off) to 10 Hz 0 to 100 %RH 0.04% RH 0 (off) to 10 Hz Humidity 0 to > 20 uV<100 mlx 0 (off) to 4 Hz Light

Environmental Specifications >> More Information

Parameter Range Notes

Operating Temperature -10°C to 80°C (14°F to 176°F)

Recommended Storage 15°C to 30°C (59°F to 86°F) Recharging Temperature 0°C to 45°C (32°F

Temperature to 113°F)

Humidity 0 to 95 %RH Non-Condensing

Pressure 20 kPa to 110 kPa (2.9 psi to Absolute Pressure

16.0 psi)

Shock Limit >3,000 g Refer to Shock Report (PDF)

No Electric Field Susceptibility 2 MHz to 18 GHz @ 200 V/m

No Magnetic Field

20 Hz to 18 GHz @ 200 V/m

Refer to EMI Test Report (PDF)

Susceptibility

30 Hz to 100 kHz


Refer to EMI Test Report (PDF)

Battery & Storage Performance >> Battery Specifications >> Battery Life Estimator

Battery performance is heavily dependent upon the device configuration (sensor sample rates and triggers), battery age (including charging cycles), and temperature. The following table provides the battery life and storage capacity of this device assuming it has a relatively new battery and it is at room temperature. When showing performance it assumes all sensors are on at the default sample rate with the main accelerometer sample rate driving performance. With triggers, it assumes the device is in trigger mode 99% of the time. Here are some additional resources: Measurement Settings, Battery Specifications, Battery Life Estimator Tool.

Sample	Storage	Continuous	Main Accel.	2nd Accel.	Periodic/Time
Rate	Capacity	Recording	Trigger	Trigger	Trigger
50 Hz	64 days	17 hours	53 hours		64 days
200 Hz	39 days	17 hours	53 hours		64 days
800 Hz	15 days	16 hours	53 hours		60 days
3,200 Hz	4 days	13 hours	52 hours		52 days
Dimensions>> Download CAD Model					



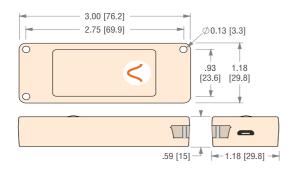

Mechanical Specifications >> Mounting

Mass 40 grams Case Material Polycarbonate Mounting - Screw 4-40 Bolts (70 in-oz)

Mounting - Tape (Double Sided) 3M 950 Tape Length 76.2 mm (3.00") Width 29.8 mm (1.18") **Thickness** 15.0 mm (0.59") **Ingress Protection** IP 50 (Dust Protected)

Free Software Features >> More Information

- Free Standalone Software Packages Lab - Configuration, Quick Snapshot, Batch File Conversion Analyzer - Analysis of enDAQ Sensor Data in MATLAB
- Configure Sensors for Measurement
- Export/Convert Data to CSV or MATLAB
- Analysis

FFT PSD

Spectogram Digital Filtering

